

ANTREX Electronics

Electronic Components Sourcing Information

Product Reference Information

Part Number: 15087-1K0797

Manufacturer: Eaton - Bussmann Electrical Division

Package: Bulk


Availability: Please confirm with sales

Product Page:

<https://antrexco.com/product/details/eaton-bussmann-electrical-division/15087-1k0797.html>

Request a Quote:

[Submit RFQ for this part](#)

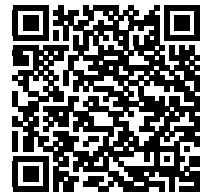

Scan for product page

Contact Information

Email: info@antrexco.com

WhatsApp: +86-186-8066-5326

Website: <https://antrexco.com>

Quality & Trust

New & Original Components

Supplier verification and packaging condition review

CoC / RoHS / REACH documents available on request

Secure sourcing support for OEM / EMS projects

Note:


This PDF includes an ANTREX product reference cover page.

The original manufacturer datasheet follows from the next page.


CONFIDENTIAL: THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF COOPER INDUSTRIES, INC. IT IS NOT FOR PUBLIC DISCLOSURE. POSSESSION OF THIS INFORMATION DOES NOT CONSTITUTE AN AUTHORIZED REPRODUCTION OR USE OF THE INFORMATION FOR ANY PURPOSE OTHER THAN THAT AUTHORIZED BY COOPER INDUSTRIES, INC. UNLESS OTHERWISE INDICATED BY THE INFORMATION IT IS LOANED OR UPON REQUEST.

UNLESS OTHERWISE SPECIFIED TOLERANCES TO BE: METRIC $\pm .13\text{mm}$ INCHES $\pm .005"$ ANGULAR $\pm 2^\circ$

(O) INDICATES CRITICAL DIMENSION OR FEATURE 55197

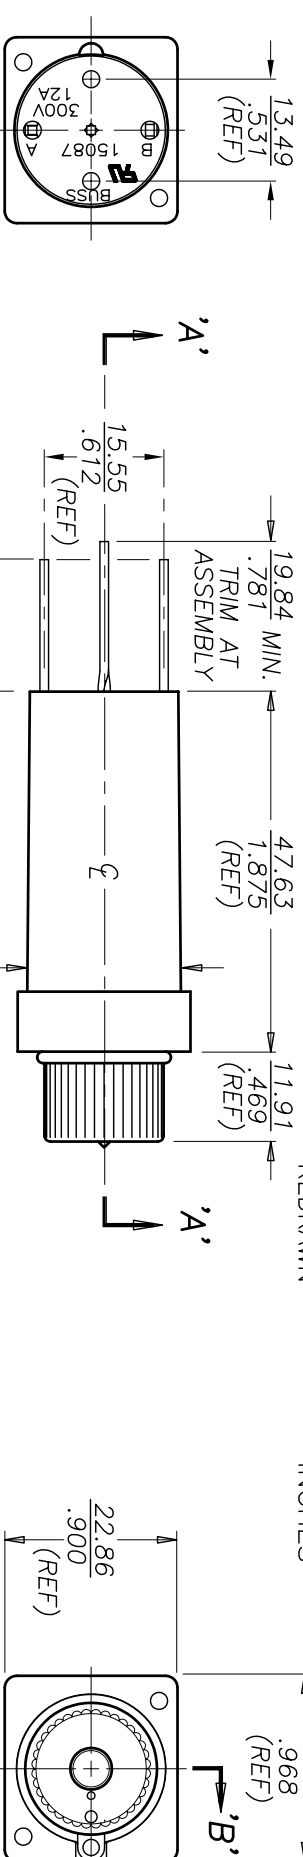


SECTION 'A'-A'

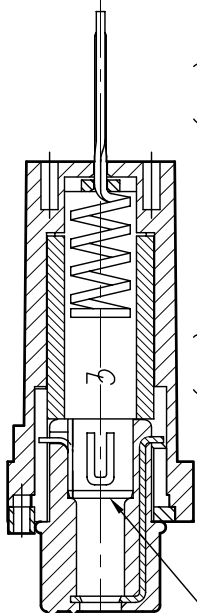

CONTACT #B105-6065
FUSEHOLDER CAP ASSEMBLY #1A5219-01N
SCREW #B002-6228 (SEE NOTE 2) (D)

PACKAGING SPECIFICATION #1P0510

MOUNTING HOLE

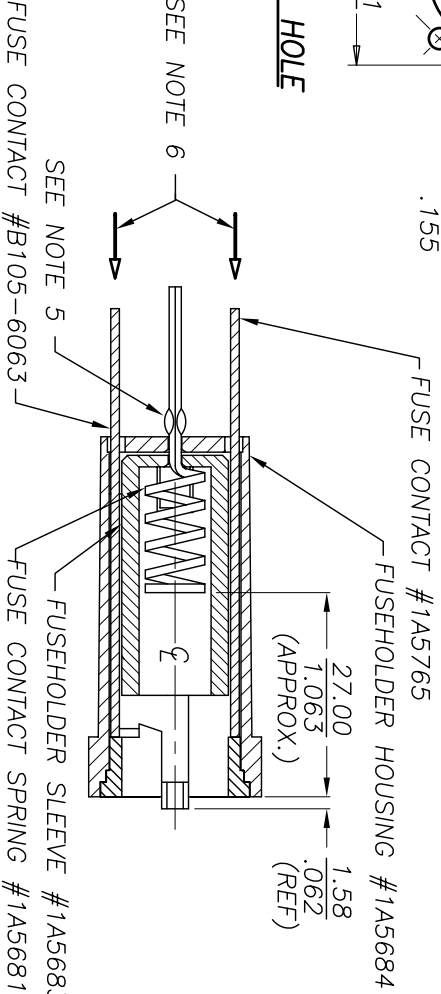

SECTION 'B'-B'

- NOTES:
- 1) FUSEHOLDER CAP ASSEMBLY AND FUSEHOLDER HOUSING ASSEMBLY ARE SHOWN ASSEMBLED FOR REFERENCE ONLY. CAP AND HOUSING WILL BE SUPPLIED, NOT ASSEMBLED, PER SUB-ASSEMBLY PART NUMBERS.
 - 2) TWO (2) SCREWS, #B002-6228, SHIPPED BULK WITH EACH ASSEMBLY.
 - 3) U.L. RECOGNIZED UNDER MODEL NO. 15087, FILE NO. E37864.
 - 4) ELECTRICAL RATING: 12 AMPS - 300 VOLTS.
 - 5) PLAINSH TERMINAL, SO SPRING WILL NOT FALL OUT (AT ASSEMBLY).
 - 6) FUSEHOLDER SLEEVE SHALL NOT SEPERATE FROM FUSEHOLDER HOUSING WHEN SUBJECTED TO A 30 LB. FORCE IN THE DIRECTION INDICATED.